USER MANUAL H-5041

LIGHT **(A Key)** ——— ——— **(D Key)** START

MODE **(B Key)** ——— ——— **(C Key)** RESET
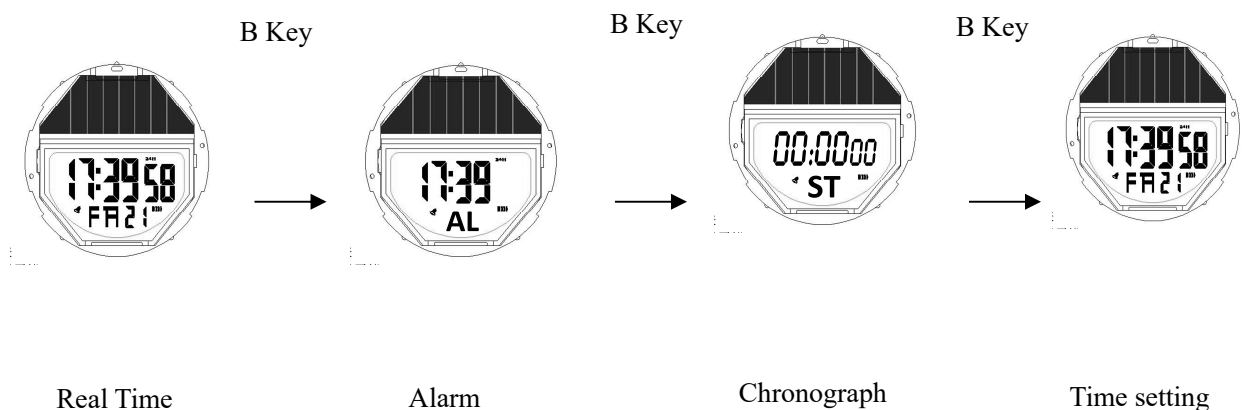
A . Features

➢ 10 Digits LCD Display, Display Hour, Minute, Second, Date and week.

➢ Daily Alarm and Chime hourly

➢ 12 / 24H format selectable

➢ 1/100 second Chronograph with split functions

➢ EL backlight

➢ Without sun or light, the watch power come from the battery.

➢ In the sun or light source, the solar panel can accept solar / light power, and supply it to the watch for work, no need battery power.

B . Operational Manual

B Key   B Key   B Key

Real Time   Alarm   Chronograph   Time setting

USER MANUAL H-5041

1. Real Time

➢ Press D key to convert 12/24 time, the screen shows "24H" when it is the 24hour mode.

2. Daily Alarm

➢ Turn On / Off Alarm and Chime: In Alarm mode ("Hour" and "Minute" do not flashing), press D key to turn on/off the Alarm :(🔔) and Chime: (🔊) in turn.

➢ The Alarm opening sign (🔔) and the Chime opening sign (🔊) are displayed in all function modes.

➢ Whatever function mode is currently displayed, the Alarm will ring for 20 seconds when it reaches the preset time and the Alarm sign (🔔) will flash during the Alarm.

➢ After turning on the Chime, sound (BI BI) will be issued at every Chime hour.

➢ Alarm setting: Press C key to select "Hour" or "Minute" setting, Press D key to adjust the flashing item, Press C key to confirm, Press B key to return to Real Time mode.

3. Chronograph

➢ The display range of the Chronograph is 59 minutes, 59.99 seconds.

➢ If the Chronograph is not stopped, even if the Chronograph function is exited, the test time will continue.

➢ If the Chronograph function is withdrawn, the halfway time will be cleared and the picture will return to the time-lapse measurement screen when the halfway time is displayed in the screen.

➢ Press D key to Start/Stop running.

➢ When stop, press C key to zero.

➢ When running, press C key to split count.

➢ When press D key to exit split count.

➢ Press C key to Chronograph, that is to record the completion time of the first player.

➢ Then press D key to complete the measurement, record the completion time of the second players and finally press C key to clear the record.

4. Time Setting

➢ "Second" flashing when loading, press D key to zero; Press C key to select item as following sequence: Minute, Month, Day, Week.

➢ When running, press B key to return to Real Time Mode.